

P0546

Fault code description

Temperature after BPV - Voltage too high or short circuit to supply

Possible cause

1. Faulty wiring
2. Faulty connector
3. Faulty sensor

Additional information

-

Set condition of fault code

-

Reset condition of fault code

-

M028551 - 07/23/2015 03:09:11

This information applies exclusively to the entered chassis number or the selected engine type. Please take into account that this information may change daily. Therefore the provided information is only valid on 12-13-2015. You cannot derive any rights from the information provided with respect to vehicles and/or components of another series, with another chassis number, and/or of another date. (/)

P0546, Diagnostic information

Technical data

["Sensor, temperature after BPV \(F853\)"](#)

Location of component(s)

["Location information, PMCI-2"](#)

Electrical diagram(s)

["PMCI-2"](#)

Description of component(s)

["Temperature after BPV sensor \(F853\)"](#)

Block diagram

["PMCI-2"](#)

Step by step troubleshooting



Please perform the troubleshooting steps below by utilising the breakout harness if necessary to check electrical components such as sensors, electrical control units or harnesses. Back probing is not recommended as it could damage the harness. The ignition should always be in the **OFF** position when connecting or disconnecting electrical components, to reduce the likelihood of damage to electrical components



- This troubleshooting tree is based on the assumption that supply power and earth to the PMCI is functioning properly.
- Disconnecting the PMCI connectors during the troubleshooting process will result in multiple errors.
- For specific electrical component information and pin out locations, always refer to Rapido.
- It is necessary to exit the '**active errors**' screen in DAVIE and run the diagnostic test again to identify any change in errors.
- Remember that the truck's operational or mechanical issues may be the root cause of both active and inactive codes. Refer to the 'possible causes' section in Rapido.

Step 1

Visual inspection - Visually inspect all applicable connectors and harnesses for corrosion, damage and rubbing during each step of the diagnostic procedure. Proceed to step 2.

Step 2

With key **OFF**, disconnect the harness from the temperature sensor. Turn the key on and measure the voltage between a battery earth and the supply terminal of the pressure sensor circuit on the engine harness:

- If the voltage is above 5.5 V – Proceed to step 4.
- If the voltage is below 5.5 V – Proceed to step 3.

Step 3

With key **OFF**, install a jumper wire between the supply and earth wires of the temperature sensor connector on the engine harness. Turn the key **ON** and navigate through DAVIE to read errors:

- If **P0545** – Replace the sensor and reconnect the harness, and then proceed to verification procedure listed at the end of this document.
- If **P0546** – Proceed to step 4.

Step 4

With key **OFF**, disconnect the engine harness from the PMCI and install a jumper wire between the supply and earth pins of the sensor circuit on the PMCI. Turn the key **ON** and navigate to read errors:

- If **P0545** – Replace the engine harness and proceed to the verification procedure listed at the end of this document.
- If **P0546** – Proceed to step 5.

Step 5

Possible PMCI failure – Contact the Engine Support Center for further instructions on replacement of the PMCI.

Verification procedure

With DAVIE connected and key **ON**, clear the errors. Start the engine and let it idle to verify with DAVIE that the errors do not re-occur.

M046382 - 07/22/2015 16:06:44

This information applies exclusively to the entered chassis number or the selected engine type. Please take into account that this information may change daily. Therefore the provided information is only valid on 12-13-2015. You cannot derive any rights from the information provided with respect to vehicles and/or components of another series, with another chassis number, and/or of another date. (/)