U1047

Fault code description

VTG turbo charger actuator learning - Incorrect

Possible cause

- Wrong software programmed in the ECU PMCI-2
- damaged actuator

Additional information

-

Set condition of fault code

-

Reset condition of fault code

-

M027672 - 07/22/2015 15:08:15

This information applies exclusively to the entered chassis number or the selected engine type. Please take into account that this information may change daily. Therefore the provided information is only valid on 12-19-2015. You cannot derive any rights from the information provided with respect to vehicles and/or components of another series, with another chassis number, and/or of another date. (/)

U1047, Diagnostic information

Technical data

"Actuator, rotary speed (L037)"

"CAN connections of PMCI-2 electronic unit (D365)"

Location of component(s)

"Location information, PMCI-2"

Electrical diagram(s)

"PMCI-2"

Description of component(s)

"Actuator, rotary speed (L037)"

Block diagram

"PMCI-2"

Step by step troubleshooting



Please perform the troubleshooting steps below using the breakout harness if necessary to check electrical components such as sensors, electrical control units or harnesses. Back probing is not recommended as it could damage the harness. The ignition should always be in the OFF position when connecting or disconnecting electrical components, to reduce the likelihood of damage to electrical components.



- This troubleshooting tree is based on the assumption that supply power and earth to the PMCI are functioning properly.
- Disconnecting the PMCI connectors during the troubleshooting process will result in multiple errors.
- For specific electrical component information and pin out locations, always refer to the technical data in Rapido.
- Exit the 'active errors' screen in DAVIE and run the diagnostic test again to identify a change in errors.
- Remember that the truck's operational or mechanical issues may be the root cause of both active and inactive codes. Refer to the 'possible causes' section in Rapido.

Step 1

With DAVIE connected and key ON, reprogram the engine basis software with the most recent PRS file.

Navigate through DAVIE and monitor errors.

If the fault is still active – Proceed to step 2.

If the fault is NO longer active – Proceed to the verification procedure.

Step 2

Has the actuator recently been removed or replaced?

- Yes Repeat the installation procedure.
 Proceed to the verification procedure.
- No Proceed to step 3.

Step 3

Check if the fault status has changed to inactive if the engine idles for more than ten seconds. Has the fault status changed to inactive?

- Yes Proceed to the verification procedure.
- No Proceed to step 4.

Step 4

With the actuator connector disconnected, turn the key to ON position. Check the voltage between the earth terminal and the supply terminal circuit at the connector harness. (Refer to the OEM manual for the system voltage)

- If the voltage found is within the specifications – Proceed to step 5.
- If the voltage found is NOT within the specifications – Check the PMCI-2 ECU for other active faults and solve these first.

Step 5

With key OFF, remove the rotary speed actuator. Check the turbo selector gear travel. Is the turbo selector gear travel within the specifications?

- Yes Proceed to step 6.
- No Clean the turbo (VTG) and proceed to the verification procedure.

Step 6

Check the actuator output gear for damage. Is the actuator output gear damaged?

- Yes Contact the Engine Support Center for further instruction on replacement of the actuator.
- No Proceed to step 7.

Step 7

Check the actuator output gear for adequate rotation (minimum of one complete rotation). Is the actuator output rotation adequate?

- Yes Proceed to step 8.
- No Contact the Engine Support Center for further instruction on replacement of the actuator.

Step 8

Contact the Engine Support Center for further instruction.

Verification procedure

With DAVIE connected and key ON, clear the errors. Start the engine and let it idle to verify with DAVIE that the errors do not re-occur.

M046980 - 07/22/2015 17:04:34

This information applies exclusively to the entered chassis number or the selected engine type. Please take into account that this information may change daily. Therefore the provided information is only valid on 12-19-2015. You cannot derive any rights from the information provided with respect to vehicles and/or components of another series, with another chassis number, and/or of another date. (/)